
## **M DIN 376 ISO 3/6G** Компас стр. 19







d1	Р	d2	SW	dk	l1	12
	ММ	ММ		ММ	ММ	ММ
М 3	0,50	2,200		2,500	56,00	6,00
M 4	0,70	2,800	2,10	3,300	63,00	7,50
M 5	0,80	3,500	2,70	4,200	70,00	8,50
M 6	1,00	4,500	3,40	5,000	80,00	11,00
M 7	1,00	5,500	4,30	6,000	80,00	11,00
M 8	1,25	6,000	4,90	6,800	90,00	14,00
M10	1,50	7,000	5,50	8,500	100,00	16,00
M12	1,75	9,000	7,00	10,200	110,00	18,50
M14	2,00	11,000	9,00	12,000	110,00	20,00
M16	2,00	12,000	9,00	14,000	110,00	20,00
M18	2,50	14,000	11,00	15,500	125,00	25,00
M20	2,50	16,000	12,00	17,500	140,00	25,00
M22 M24	2,50	18,000	14,50	19,500	140,00	27,00
M27	3,00	18,000 20,000	14,50	21,000 24,000	160,00 160,00	30,00 30,00
IVIZ/	3,00	20,000	16,00	24,000	160,00	30,00

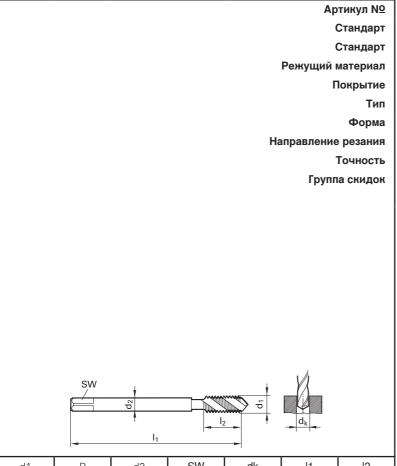